

Date: Thursday, 12/13/2007 11:14:58 AM  
 User: Kim Johnston

## Process Sheet

2

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKIDTUBE ASSEMBLY  
 Job Number : 36285  
 Estimate Number : 10022  
 P.O. Number : *N/A* Part Number : D205634011  
 This Issue : 12/13/2007 S.O. No. : *N/A* Drawing Number : *N/A*  
 Prsht Rev. : *NC* Project Number : *N/A*  
 First Issue : *N/A* Type : LANDING GEAR Drawing Revision : *N/A*  
 Previous Run : 36256 Material : *N/A*  
 Written By : Due Date : 1/10/2008 Qty: 1 Um: Each  
 Checked & Approved By : *07.12.13*  
 Comment : Est Rev: P 02.08.28 Removed QC5 from Step 5 KJ

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D205-634-011 CHG005

2.0 36285A SKID TUBE ASSEMBLY



Comment: Sub-Component SKID TUBE ASSEMBLY

D205-634-041 B *36285A*

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0 K10003 D205-634-011 Saddle Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 K10003 Saddle Kit *1334809*

5.0 QC4 INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

6.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: *E*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: D Date: 08/01/11  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/13/2007 11:14:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 36285

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

QC21

FINAL INSPECTION/W/O RELEASE



①

Comment: FINAL INSPECTION/W/O RELEASE

D08/01/11

Job Completion



u 08-01-11

36285A

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_










QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

# Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : SKID TUBE ASSEMBLY
Job Number : 36285A	
Estimate Number : 10023	
P.O. Number : N/A	Part Number : D205634041
This Issue : 12/13/2007 S.O. No. : N/A	Drawing Number : D2580 REV D
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A	Drawing Revision : D
Previous Run : 36256A	Material : N/A
Written By : _____	Due Date : 1/10/2008
Checked & Approved By : _____	Qty: 1 Um: Each
Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ	
Est Rev. O 06.02.28 Added paperwork EC	
Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM	
Additional Product	
Job Number: 	
Seq. #:	Machine Or Operation: Description :
1.0	DC DOCUMENT CONTROL
 	
Comment: DOCUMENT CONTROL	
Photocopy D205-634 bluefile & type labels per PPP D205-634 CHG002	
2.0	D25001190 Extn -1" Beam Tube 4"
 	
Comment: Qty.: 1.0400 Each(s)/Unit Total : 1.0400 Each(s)	
Pick:	
Qty Part Number	Description Batch
1 D2500-1-190	Skid Tube Extrusion 634729
3.0	D2596 205 Web
 	
Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)	
Pick:	
Qty Part Number	Description Batch
1 D2596	205 Web 35995
4.0	LANDING GEAR 1 LANDING GEAR RESOURCE 1
 	
Comment: LANDING GEAR RESOURCE 1	
1- Inspect mat'l D2500-1-190 for damage	
2-Cut D2500-1-190 per Dwg D2580 if necessaryDeburr ends	
3-Acid etch and Alodine tube per QSI 005 4.1	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 7-12-20

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 105488

Sikaflex expire date: 8-7-1

Start Time: 4:00 Date: 7-12-20

Fin Time: 10:45 Date: 7-12-21

SL 7-12-20

7.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

EL 7-12-21

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

7-12-27

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



# Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08-01-02

10.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2576-3

Step

B33464

BE 08-01-02

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

B34789

BE 08-01-02

12.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

M106330

BE 08-01-02

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

M106330

BE 08-01-02

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Deburr

AWM 08-01-02

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

U 8-1-2

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Deburr

AWM 08-01-02

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

U 8-1-2

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action		Sign & Date	Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng				

NOTE: Date & initial all entries

Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 08-01-03 ①

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/01/03 ①

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FD 08/01/07 ①

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 106379

PR 08-01-08 ①

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FD 08/01/09 ①

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B34349

FD

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M100188

FD

20.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M104374

FD 08/01/09 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

21.0

ALS71032130

Insert



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: m105729

FX

22.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: m106853

FX

23.0

AN960C10L

washer



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: m106662

FX

24.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: D32744

FX

25.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B36113

FX

26.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B36339

FX

27.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B33867

FX 08/01/09 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

28.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34805

FL

29.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B34807

FL

30.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B36111

FL

31.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B27168

FL

32.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B33450

FL

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

Sikaflex expire date: 08-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

FL 08/01/09 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: PD Date: 08/01/11  
 QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Thursday, 12/13/2007 11:15:18 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 36285A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date: 08-07

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M 106332

F2 08/01/09 ①

BR 08-01-09 ①

34.0

QC5

INSPECT WORK TO CURRENT STEP



08/01/09 (x)



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PPP 36285

8/1/10 (1x) SP

36.0

QC21

FINAL INSPECTION/W/O RELEASE



①

Comment: FINAL INSPECTION/W/O RELEASE

08/01/11

Job Completion



08.01.11

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



DESIGN #	DRAWN BY RH	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED  
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 36285A

**Copyright © 1996 by DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Diagram illustrating the underside of the D2576-3 step, showing the locations for grinding flush and the location ridge on the underside of the D2576.

Labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576

NO. 56285A

WORK ORDER

UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

DRILL PRIOR TO D2855 CAP  
INSTALLATION (2 PLACES)

AN3-5A BOLT (1)  
AN960JD10L WASHER (1)  
(2 PLACES)

D2855 CAP

0.40

SHOP COPY  
RETURN TO  
ENGINEERING

SECTION D-D  
SCALE 5:24

D2579 SPACER

D2596 WEB (REF)

AL57-1032-130 (REF)  
(TYP 50 PLACES)

AFTER PERFORM  
1. CHAMFER  
2. INSIDE  
3. WELD  
4. C'BO

D2579 SPACER

D2596 WEB (REF)

7-1032-130 (REF)  
(TYP 50 PLACES)

AFTER PERFORATION

1. CHA
2. INS
3. WEL
4. C'B

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50  
DISTANCE TO AFT END  
OF D2596 WEB

3  
7

0.508 (TYP.)  
(40 PLACES)

REFER TO DETAIL A

1.750 1.750

8.750

17.375

26.000

34.188

57.313 (REF)  
7 EQUAL SPACES  
8.188 PITCH

38.0

91.500

190.0  
(D2500-1)

REFER TO DETAIL A

[illegible]

D3560-041 ASSEMBLY DETAIL

WELD AS PER DETAIL B

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

0.5 1.5 1.5

D

8

P P P P P P P

REFER TO DETAIL C

D3566-1 D3566-5 D3566-1 D3566-13

D3564-11 D3564-5 D3564-9 D3564-13

AN3C4A BOLT (1)  
AN560C10L WASHER (1)  
(50 PLACES)

DESIGN	2	DRAWN BY	
--------	---	----------	--

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN	<i>[Signature]</i>	DRAWN BY	<i>PH</i>
CHECKED	<i>[Signature]</i>	APPROVED	<i>[Signature]</i>
DATE			
07.02.27			

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the step with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

RELEASED  
07 Dec 78

Diagram illustrating the rear view of the engine block assembly, showing the installation of the D2855 cap and AN3-5A bolt. The diagram includes the following labels and dimensions:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-5A BOLT (1)
- AN960JD10L WASHER (1) (2 PLACES)
- D2855 CAP
- SEE NOTE ii)
- 0.40

D2579 SPACER

D2596 WEB (REF)

7-1032-130 (REF)  
(TYP 50 PLACES)

AFTER PERFOR

1. CHA
2. INS
3. WEL
4. C'B

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

37.50  
DISTANCE TO AFT END  
OF D2596 WEB

3  
7

1.750 1.750

0.508 (TYP.)  
(40 PLACES)

REFER TO DETAIL E

REFER TO DETAIL A

8.750

17.375

26.000

34.188

57.313 (REF)  
7 EQUAL SPACES  
8.188 PITCH

38.0

91.500

190.0  
(D2500-1)

(MAKE FROM D2580-1 DRILLING DETAIL)

5.985  
1.4  
51.340  
5.338 (REF)  
39.580  
5.915  
3.630 (REF)  
Ø0.508 (8 PLACES)  
20.0  
Ø0.640  
11  
1.0  
DISTANCE BETWEEN HOLE AND TANGENT POINT  
13.4  
1.0  
DISTANCE BETWEEN HOLE AND TANGENT POINT  
32.0 ± 1.0  
4

**D3560-V49 ASSEMBLY DETAIL**

WELD AS PER DETAIL F

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

NO C'BORE NO PLUG

REFER TO DETAIL G

H

P P P P P P P P

8

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13

AN3C4A BOLT (1)

AN960C10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY
--------	----------

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN <i>RH</i>	DRAWN BY <i>RH</i>
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>
DATE 07.02.27	

DRAWING NO.	REV. D
D2580	SHEET 3 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

NO. 133

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay Elliot  
Joint Welding Procedure ti  
Part number and Job number D205 63401 / B35642

TEST WELDS REQUIRED

BASE METAL Aluminium WELDING PROCESS ti  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input checked="" type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2E <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-11-27

Qualifier P. J. D.